

Service-Information Motorcycle



BMW of N.A.
Service Department

Group: 61
General
Electrics

July 1985

61 012 85
(2166)

For USA and Canada
Only

Engine to Frame Ground -- All K100's

Condition: Fan and coolant light comes on prematurely.
Engine is neither hot nor at normal operating temperature.

Reason: Engine to frame ground connection is insulated by frame paint.

Remedy: Remove the frame to bell housing bolt.
Clear paint from the frame and retorque engine mount, using copper Never Siese under the head of the bolt.

Torque the bolts to specifications:
32 Nm (23 ft. lbs.).

Very truly yours,

BMW OF NORTH AMERICA, INC.

A handwritten signature in black ink, appearing to read 'Richard Dampf'.

Richard Dampf
National Technical Manager
Motorcycle Group

RD:ch